

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

ORIGINAL

FIELD NOTES

OF

THE DEPENDENT RESURVEY OF
PORTIONS OF THE EAST AND NORTH BOUNDARIES,
A PORTION OF THE SUBDIVISIONAL LINES,
THE SUBDIVISION OF SECTIONS 1 AND 12

AND

THE RETRACEMENT OF A PORTION OF THE
WESTERLY RIGHT OF WAY LINE OF UTAH STATE HIGHWAY NO. 59,

IN

TOWNSHIP 42 SOUTH, RANGE 13 WEST

OF THE SALT LAKE MERIDIAN
IN THE STATE OF UTAH

EXECUTED BY


Larry V. Judd
Cadastral Surveyor

Under special instructions dated *July 21, 2000*, approved *July 21, 2000*,
which provided for the surveys included under Group Number *917*, and
assignment instructions dated *July 25, 2000*

Survey commenced *August 16, 2000*
Survey completed *September 7, 2000*

INDEX DIAGRAM

Township 42 South , Range 13 West

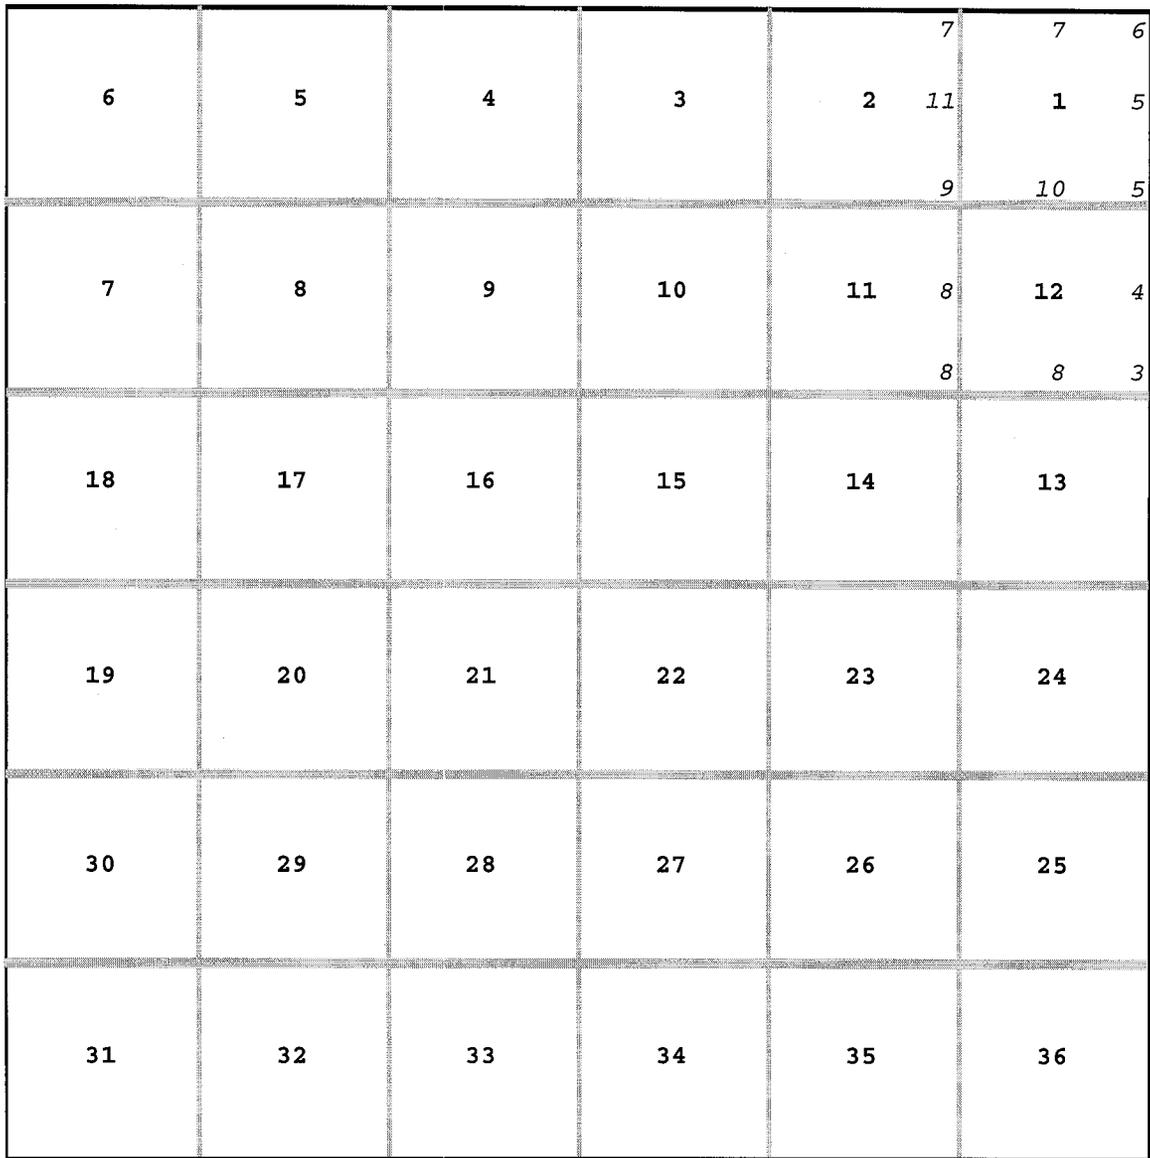

The Subdivision of Section 1.....Page 11
 The Subdivision of Section 12.....Page 14
 Retracement of the westerly right of way, Utah State Road No. 59..Page 16

TOWNSHIP 42 SOUTH, RANGE 13 WEST, SALT LAKE MERIDIAN, UTAH

The following field notes are those of the dependent resurvey of portions of the east and north boundaries, a portion of the subdivisional lines, the subdivision of sections 1 and 12, and the retracement of a portion of the westerly right of way line of Utah State Highway No. 59, in Township 42 South, Range 13 West, Salt Lake Meridian, Utah.

History of Surveys

Surveyed by		Retr. or Resurveyed by	
SOUTH BOUNDARY			
All	Jenkins and West	1897	
All	Stewart Jr. and Snow	1909	
EAST BOUNDARY			
Portion	Bailey and Burrill	1877	
All	Jenkins and West	1897	Jenkins and West 1897
Portion			R.K. Baugh 1999
WEST BOUNDARY (Second Guide Meridian West)			
All	J. Bausman	1870	
All			Jenkins and West 1897
Portion			M.H. Dalley 1899
All			C.P. Sylvester, etal 1978-79
NORTH BOUNDARY			
All	Bailey and Burrill	1877	
All			Jenkins and West 1897
Portion			Stewart Jr. and Snow 1909
Portion			C.P. Sylvester, etal 1978-79
SUBDIVISION			
Portion	Bailey and Burrill	1877	
Portion			Jenkins and West 1897
Portion	Stewart Jr. and Snow	1909	Stewart Jr. and Snow 1909

PRIVATE SURVEY

L.R. Pope Engineers and Surveyors of St. George Utah, executed a survey for Del Stansworth in sections 1 and 2 of T. 42 S., R. 13 W., with plat dated July 1994.

The survey was executed in accordance with the specifications set forth in the Manual of Surveying Instructions, 1973, and the Special Instructions for Group No. 917, Utah, dated July 21, 2000.

The directions of lines were determined by references to true meridians established by the Global Positioning System, utilizing Real Time Kinematic (RTK) survey techniques observed with Trimble 4700 model Global Positioning System receivers along with Pacific Crest radio equipment.

TOWNSHIP 42 SOUTH, RANGE 13 WEST, SALT LAKE MERIDIAN, UTAH

Preliminary to the resurvey, retracement and survey, the lines of the prior surveys were retraced and a diligent search was made for all corners and other calls of record. Identified corners were remonumented in their original positions. The retracement data were thoroughly verified and only the true line field notes are given herein.

Geodetic control was derived from National Geodetic Survey triangulation station "MESA", with published data as follows:

Latitude 37° 02' 03.894650" N. Longitude 113° 15' 01.353150"W. N.A.D. 1983 (1994)

The geographic position of the corner of sections 7, 12, 13, and 18, on the east boundary of the township as determined by a tie made to National Geodetic Survey triangulation station "MESA", is as follows:

Latitude 37° 08' 29.340" N Longitude 113° 15' 20.409" W.
N.A.D. 1983

DEPENDENT RESURVEY OF A PORTION OF THE EAST BOUNDARY,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

Dependent Resurvey of a Portion of the East Boundary,
T. 42 S., R.13 W., Salt Lake Meridian, Utah.

Reestablishment of the Survey Executed by
J.C. Burrill in 1877 and the Resurvey by
Jenkins and West in 1897.

From the corner of sections 7, 12, 13 and 18 on the east boundary of the township, monumented with an aluminum post, 2 1/2 inches diameter, firmly set, projecting 4 inches above ground, with the aluminum cap marked as described in the official record of resurvey executed by R.K. Baugh in 1999.

Set a steel fence post alongside the aluminum post.

From this corner, National Geodetic Survey triangulation station "MESA" monumented with a standard brass disk set in solid sandstone, bears S. 2° 16.2' E., (forward bearing) and N. 2° 16.0' W., (back bearing) for a distance of 591.243 chains.

N.0° 15.7' E., along the east boundary of the township, between sections 7 and 12.

20.196 Point for the S 1/16 section corner of section 12 only.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T42S
R13W R12W
S 1/16 |
S12 |
2000

Raise a mound of stone, 3 ft. base by 1 ft. high, west of the aluminum post.

Set a steel fence post alongside the aluminum post.

33.419 Intersect the westerly right of way line of Utah State Highway No. 59.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked: AP S12 2000, with lines of intersection.

Raise a mound of stone, 3 ft. base by 1 ft. high, west of the aluminum post.

Set a steel fence post alongside the aluminum post.

DEPENDENT RESURVEY OF A PORTION OF THE EAST BOUNDARY,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

- 38.994** Point for the 1/4 section corner of section 7 only, T. 42 S., R. 12 W.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 30 inches in the ground, with the aluminum cap marked:

```

T42S
  | 1/4
  | S7
R13W R12W
  2000

```

The corner falls, 9 ft. east of the E edge of Utah State Highway No. 59, which bears N.19° 18' W., and S.19° 18' E.

- 40.392** Point for the 1/4 section corner of section 12 only, T. 42 S., R. 13 W. at proportionate distance. No remaining evidence of the original corner was found.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

```

T42S
R13W R12W
  1/4 |
  S12 |
      2000

```

Raise a mound of stone, 4 ft. base, by 1 ft. high to the west of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls 43 ft. east of the E edge of Utah State Highway No. 59, which bears N. 19° 18' W., and S. 19° 18' E.

- 78.936** The closing corner of sections 6 and 7 only, T. 42 S., R. 12 W., monumented with a sandstone, 24x10x8 ins., loosely set, marked with a plain CC on the E face and 1 plain notch on the N edge and 3 plain notches on the S edge. (Record 5 notches S edge)

At the corner point.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 26 inches in the ground, with the aluminum cap marked:

```

T42S
R13W R12W
  C | S6
  C | S7
      2000

```

Buried the marked rock alongside the aluminum post.

Raise a mound of stone, 4 ft. base, by 1 ft. high to the east of the aluminum post.

DEPENDENT RESURVEY OF A PORTION OF THE EAST BOUNDARY,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

The corner falls on a gradual west slope, 26 ft. east of the bottom of a drainage, 4 ft. wide, drains northwest.

- 80.733** The corner of sections 1 and 12 only, T. 42 S., R. 13 W., monumented with an iron post, 3 ins. diameter, firmly set, projecting 18 ins. above ground, with the brass cap marked T42S R12W R13W S1 S12. Reset the iron post to project 12 inches above ground, at its same location.

Raise a mound of stone, 3 ft. base, by 2 ft. high, to the east of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls in the bottom of a small drainage, drains northwest.

N. 0° 28.1' E., continuing along the east boundary of the township, with new measurement, between sections 1 and 6.

- 20.132** Point for the S 1/16 section corner of section 1 only, not monumented.

- 38.204** Point for the 1/4 section corner of section 6 only, T. 42 S., R. 12 W.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T42S
R13W R12W
 | 1/4
 | S6
 2000

Raise a mound of stone, 3 ft. base, by 1 ft. high, to the east of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on flat ground in bottom drainage lands.

- 40.264** The 1/4 section corner of section 1 only, T.42S.,R.13W., monumented with a sandstone, 16x12x4 ins. loosely set in the center of a mound of stone, 4 ft. base, by 1 ft. high, with no visible marks on the stone. The west side and a part of the north and south edges of the stone have chipped off. This stone is considered to be the original stone, and is accepted as such.

At the corner point.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 26 inches in the ground, with the aluminum cap marked:

DEPENDENT RESURVEY OF A PORTION OF THE EAST BOUNDARY,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

T42S
R13W R12W
1/4 |
S1 |
2000

Raise a mound of stone, 4 ft. base, by 2 ft. high to the west of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on flat ground, approximately 40 ft. west of the toe of a small ridge, 20 ft. high, bears northwest and southeast

N. 0°15.0' E., beginning new measurement.

- 40.310** The corner of sections 1, 6, 31 and 36, Townships 41 and 42 South, Ranges 12 and 13 West, monumented with an iron post, 3 ins. diameter, firmly set in a mound of stone, 4 ½ ft. base, by 2 ft. high, with the brass cap marked T41S S1 S6 S31 S36 T42S 1909 R12W R13W.

The corner falls on top of a flat ridge, which bears NW and SE.

Dependent Resurvey of a Portion of the North Boundary,
T. 42 S., R. 13 W., Salt Lake Meridian, Utah

Reestablishment of the Survey executed by
Bailey and Burrill in 1877, and the
Resurvey executed by Jenkins and West in 1897

From the corner of sections 1, 6, 31 and 36, Townships 41 and 42 South, Ranges 12 and 13 West, hereinbefore described.

S. 89°57.1' W., along the north boundary of the township, between sections 1 and 36.

- 20.100** The E 1/16 section corner of sections 1 and 36, monumented with a rebar without identifying cap and a steel fence post. This monument is accepted as the E 1/16 section corner position.

Set an aluminum post, 30 inches long, 2 ½ inches diameter, 8 inches in the ground, in a mound of stone, 4 ft. base to top of the aluminum cap marked:

T41S R13W
S36
E 1/16 ———
S1
T42S R13W
2000

DEPENDENT RESURVEY OF A PORTION OF THE NORTH BOUNDARY
T. 42 S., R. 13 W., SALT LAKE MERIDIAN UTAH

Chains

Deposit the rebar inside the aluminum post.

The corner falls 21 ft. south of the center of a dirt road, projecting east and west and 23 ft. west of the same road, projecting north and south, with the road, 12 ft. wide.

- 40.200** The 1/4 section corner of sections 1 and 36, monumented with a limestone, 16x10x5 ins., firmly set, plainly marked 1/4 on the north face and with a cross (X) on top of the stone.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T41S R13W
S36
1/4 ———
S1
2000

Buried the marked stone alongside the aluminum post.

Raise a mound of stone, 2 ft. base, by 1 ft. high to the north of the aluminum post.

The corner falls on flat ground, in a fence line, projecting east and west.

S. 89°57.8' W., beginning new measurement.

- 39.874** The corner of sections 1, 2, 35 and 36, Townships 41 and 42 South, Range 13 West, monumented with an iron post, 2 1/2 inches diameter, firmly set in a mound of stone, 3 1/2 ft. base, by 1 ft. high, with the brass cap marked as described in the official record of the survey executed by C.P. Sylvester in 1978.

The corner falls on a gradual east slope in a fence line projecting east and west, underneath a power line.

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 42 S., R. 13 W., Salt Lake Meridian, Utah

Reestablishment of the Survey executed by
Bailey and Burrill in 1877

From the corner of sections 7, 12, 13 and 18, on the east boundary of the township, hereinbefore described .

N. 89° 26.9' W., between sections 12 and 13.

- 19.958** Point for the E 1/16 section corner of sections 12 and 13, not monumented.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

- 39.916** Point for the 1/4 section corner of sections 12 and 13 at proportionate distance. No remaining evidence of the original 1/4 section corner was found.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

	T42S R13W
	S12
1/4	—————
	S13
	2000

Raise a mound of stone, 2 ft. base, by 1 ft. high to the north of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on flat open ground.

- 79.832** The corner of sections 11, 12, 13, and 14, monumented with a limestone 16x12x4 ins., loosely set and plainly marked with 4 grooves on the south edge and 1 groove on the east face.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 26 inches in the ground, with the aluminum cap marked:

	T42S R13W
	<u>S11</u> <u>S12</u>
	S14 S13
	2000

The corner falls on a moderate east slope, 6 ft. west of the bottom of a drainage, 3 ft. wide, drains northeast.

Reestablishment of the Survey executed by
Bailey and Burrill in 1877 and the
Resurvey by Stewart and Snow in 1909

N. 0° 00.8' W., between sections 11 and 12.

- 40.283** The 1/4 section corner of sections 11 and 12, monumented with a limestone, 16x8x5 ins., laying loose in the center of a mound of stone, plainly marked 1/4 on one side.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

T42S R13W
1/4
S11 | S12
2000

Buried the marked stone alongside the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on top of a flat, open ridge

N. 0°26.2' E., beginning new measurement.

- 40.249** The corner of sections 1, 2, 11 and 12, monumented with a limestone, 18x10x4 inches, firmly set, plainly marked with 3 notches on the south edge. No other notches seen on the south edge or any groove or notch seen on the east edge or face. The stone is set in a large scattered mound with a steel fence post alongside.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T42S R13W
S2 | S1
S11 | S12
2000

The corner falls on a gradual open southeast slope.

Reestablishment of the Survey executed by
Bailey and Burrill in 1877

From the corner of sections 1 and 12 only, on the east boundary of the township, hereinbefore described.

N. 89°35.6' W., between sections 1 and 12.

- 16.820** Intersect the westerly right of way line of Utah State Highway No. 59.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked: AP S1 S12 2000, with lines of intersection.

Set a steel fence post alongside the aluminum post.

- 19.972** Point for the E 1/16 section corner of sections 1 and 12.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

E 1/16 $\frac{S1}{S12}$
2000

Raise a mound of stone, 4 ft. base, by 1 ft. high to the north of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on the east edge of a dim trail road, 9 ft. wide, bears northeast and southwest on flat ground.

- 39.944** Point for the 1/4 section corner of sections 1 and 12, at proportionate distance; no remaining evidence of the original corner was found.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum cap marked:

T41S R13W
S1
1/4 $\frac{S1}{S12}$
2000

Raise a mound of stone, 3 1/2 ft. base, by 2 ft. high to the north.

Set a steel fence post alongside the aluminum post.

The corner falls on a open gradual east slope, in an area of extensive old disturbance.

- 59.916** Point for the W 1/16 section corner of sections 1 and 12, not monumented.

- 79.888** The corner of sections 1, 2, 11 and 12.

N. 0°13.0' E., between sections 1 and 2.

- 19.957** Point for the S 1/16 section corner of sections 1 and 2.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground with the aluminum cap marked:

S 1/16
S2 | S1
2000

Raise a mound of stone, 3 ft. base, by 1 ft. high to the south of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls in the bottom of a small drainage, 2 - 3 ft.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

wide, drains north to northwest.

From this corner, a rebar 5/8 inch diameter, with plastic cap attached and marked LRP ENG. No. 5921, bears S. 4° 45.6' W., 1.113 chains distance. This monument was established based upon an incorrect 1/4 section corner determination and therefore not accepted.

- 39.914** Point for the 1/4 section corner of sections 1 and 2 at proportionate distance. No remaining evidence of the original 1/4 section corner was found.

Set an aluminum post, 30 inches long, 2 1/2 diameter, 16 inches in the ground, in a mound of stone, 3 ft. base, by 1 ft. high, with the aluminum cap marked:

T42S R13W
1/4
S2 | S1
2000

Set a steel fence post alongside the aluminum post.

The corner falls on the west edge of a dirt road, 8 ft. wide, bears north and south, and also 14 ft. west from the center of an above ground power transmission line.

- 79.948** The corner of sections 1, 2, 35 and 36, on the north boundary of the township; hereinbefore described.

The Subdivision of Section 1,
T. 42 S., R. 13 W., Salt Lake Meridian, Utah

From the 1/4 section corner of sections 1 and 12.

N. 0°10.3' E., on the N - S center line of section 1.

- 20.044** Point for the center S 1/16 section corner of section 1, not monumented.

- 40.088** Point for the center 1 /4 section corner, at intersection with the E - W center line of section 1.

Set a T iron, 6 inches long, set 6 inches into a crack in solid sandstone rock, with a 3 1/4 inches diameter aluminum cap attached and marked:

T42S R13W
C 1/4
S1
2000

- 80.256** The 1/4 section corner of sections 1 and 36, on the north boundary of the township; hereinbefore described.
-

THE SUBDIVISION OF SECTION 1,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

From the 1/4 section corner of section 1 only, on the east boundary of the township; hereinbefore described.

N. 89° 50.6' W., on the E - W center line of section 1.

20.074 Point for center E 1/16 section corner of section 1.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with the aluminum post marked:

$$\begin{array}{c} \text{E } 1/16 \\ \text{C} \text{ --- } \text{C} \\ \text{S1} \\ 2000 \end{array}$$

Raise a mound of stone, 3 ft. base, by 1 ft. high to the north of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls on flat ground, 23 ft. west of a dirt trail road, 10 feet wide, bears north and south.

From this corner, a rebar 5/8 inch diameter, with plastic cap attached and marked LRP ENG. No. 5921, bears S. 0° 14.7' W., 0.556 chains distance. This monument was established based upon an incorrect 1/4 section corner determination, prior to subdivision and therefore not accepted.

31.228 Intersect the westerly right of way line of Utah State Highway No. 59.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 16 inches in the ground, set in a mound of stone, 3 ft. base, to top of the aluminum cap marked: AP C S1 2000, with lines of intersection.

The corner falls within the highway right of way fence.

40.148 The center 1/4 section corner of section 1.

60.102 Point for the center W 1/16 section corner of section 1.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 8 inches in the ground, set in a mound of stone, 4 1/2 ft. base to top of the aluminum cap marked:

$$\begin{array}{c} \text{W } 1/16 \\ \text{C} \text{ --- } \text{C} \\ \text{S1} \\ 2000 \end{array}$$

The corner falls on a gradual south slope, 13 ft. north of a small drainage, 5 ft. wide, drains northeast.

THE SUBDIVISION OF SECTION 1,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

From this corner, a rebar 5/8 inch diameter, with plastic cap attached and marked LRP ENG. No. 5921, bears S. 3° 30.6' W., 1.659 chains distance. This monument was established based upon an incorrect 1/4 section corner determination, prior to subdivision and therefore not accepted.

80.056 The 1/4 section corner of sections 1 and 2.

From the center E 1/16 section corner of section 1.

N. 0° 12.6' E., on the N - S center line of the NE 1/4, of section 1.

40.239 The E 1/16 section corner of sections 1 and 36 on the north boundary of the township; hereinbefore described.

From the E 1/16 section corner of sections 1 and 12.

N. 0° 19.2' E., on the N - S center line of the SE 1/4 of section 1.

8.842 Intersect the westerly right of way line of Utah State Highway No. 59, not monumented.

20.088 Point for the SE 1/16 section corner, at intersection with the E - W center line of the SE 1/4 of section 1, not monumented.

40.176 The center E 1/16 section corner of section 1.

From the point for the S 1/16 section corner of section 1 only, on the east boundary of the township; hereinbefore described.

N. 89° 43.1' W., on the E - W center line of the SE 1/4, of section 1.

20.023 The point for the SE 1/16 section corner of section 1.

24.030 Intersect the westerly right of way line of Utah State Highway No. 59, not monumented.

40.046 The point for the center S 1/16 section corner of section 1.

From the point for the W 1/16 section corner of sections 1 and 12.

N. 0° 11.6' E., on the N - S center line of the SW 1/4 of section 1.

20.000 Point for the SW 1/16 section corner at intersection with the E - W center line of the SW 1/4 of section 1.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground with the aluminum cap marked:

THE SUBDIVISION OF SECTION 12,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

SW 1/16
S1
2000

Set a steel fence post alongside the aluminum post.

The corner falls on flat ground, 72 ft. north of a fence projecting N. 70° E., and S. 70° W.

From this corner, a rebar 5/8 inch diameter, with plastic cap attached and marked LRP ENG. No. 5921, bears S. 3° 36.7' W., 0.832 chains distance. This monument was established based upon an incorrect 1/4 section corner determination, prior to subdivision and therefore not accepted.

40.000 The center W 1/16 section corner of section 1.

From the point for the center S 1/16 section corner of section 1. N. 89° 43.1' W., on the E - W center line of the SW 1/4 of section 1.

19.963 The SW 1/16 section corner of section 1.

39.926 The S 1/16 section corner of sections 1 and 2.

The Subdivision of Section 12,
T. 42 S., R. 13 W., Salt Lake Meridian, Utah

From the 1/4 section corner of sections 12 and 13.

N. 0° 14.2' E., on the N - S center line of section 12.

20.169 Point for the center S 1/16 section corner of section 12, not monumented.

40.338 Point for the center 1/4 section corner, at intersection with the E - W center line of section 12.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground with the aluminum cap marked:

T42S R13W
C 1/4
S12
2000

Raise a mound of stone, 4 ft. base, by 2 ft. high to the west of the aluminum post.

The corner falls on a gradual open east slope.

80.632 The 1/4 section corner of sections 1 and 12.

THE SUBDIVISION OF SECTION 12,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

From the 1/4 section corner of section 12 only, on the east boundary of the township; hereinbefore described.

N. 89° 31.6' W., on the E - W center line of section 12.

- 2.479** Intersect the westerly right of way line of Utah State Highway No. 59.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, set in a collar of stone, with the aluminum cap marked: AP C S12 2000, with lines of intersection.

Set a steel fence post alongside the aluminum post.

- 19.965** Point for center E 1/16 section corner of section 12.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 26 inches in the ground, with the aluminum cap marked:

E 1/16
C ——— C
S12
2000

Raise a mound of stone, 4 ft. base, by 2 ft. high to the north of the aluminum post.

Set a steel fence post alongside the aluminum post.

The corner falls, 3 ft. west of the west edge of the bottom of a drainage, 15 ft. wide, drains northwest. The corner is set 3 ft. higher than the bottom of the drainage.

- 39.930** The center 1/4 section corner of section 12.

- 80.018** The 1/4 section corner of sections 11 and 12.

From the center E 1/16 section corner of section 12.

N. 0°15.0' E., on the N - S center line of the NE 1/4, of section 12.

- 40.318** The E 1/16 section corner of sections 1 and 12.

From the point for the E 1/16 section corner of sections 12 and 13.

N. 0° 15.0' E., on the N - S center line of the SE 1/4 of section 12.

- 20.182** Point for the SE 1/16 section corner, at intersection with the E - W center line of the SE 1/4 of section 12.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 10 inches in the ground, set in a mound of stone, 4 ft. base to top of the aluminum cap marked:

RETRACEMENT OF A PORTION THE WESTERLY RIGHT OF WAY LINE
OF UTAH STATE HIGHWAY NO. 59,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

SE 1/16
S12
2000

The corner falls on a gradual east slope, 125 ft. west of the center of an improved dirt road, 18 ft. wide, bears N. 22' E., and S. 22' W.

40.364 The center E 1/16 section corner of section 12.

From the S 1/16 section corner of section 12 only, on the east boundary of the township; hereinbefore described.

N. 89° 29.3' W., on the E - W center line of the SE 1/4, of section 12.

19.961 The SE 1/16 section corner of section 12.

39.922 The point for the center S 1/16 section corner of section 12.

Retracement of a Portion of the
Westerly right of way line of Utah State Highway No. 59,
T. 42 S., R. 13 W., Salt Lake Meridian, Utah.

From the monument on the line between sections 7 and 12, at intersection with the westerly right of way line of Utah State Highway No. 59; hereinbefore described.

From this monument, a right of way station, monumented with an iron post, 2 inches diameter, set in concrete with the attached brass cap unmarked, bears S. 19° 17.3' E., 25.402 chains distance.

N. 19° 17.3' W., on the westerly right of way line, through section 12.

0.161 Right of way station, 210+00, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 210+00 ELEV 4023.28 1966.

N. 19° 17.0' W., beginning new measurement.

7.248 The monument at the point of intersection with the E - W center line of section 12; hereinbefore described.

N. 19° 17.0' W., beginning new measurement.

7.904 Right of way station, 200+00, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 200+00 ELEV 4000.33 1966.

RETRACEMENT OF A PORTION THE WESTERLY RIGHT OF WAY LINE
OF UTAH STATE HIGHWAY NO. 59,
T. 42 S., R. 13 W., SALT LAKE MERIDIAN, UTAH

Chains

N. 19° 17.7' W., beginning new measurement.

- 34.841** Right of way station, 177+00, monumented with an iron post, 2 inches diameter, set in concrete with the attached brass cap marked, STA 1770+00 ELEV 3939.9 1961.

N. 19° 17.4' W., beginning new measurement.

- 0.102** The monument at the point of intersection with the line between sections 1 and 12; hereinbefore described.

N. 19° 17.4' W., beginning new measurement, through section 1.

- 9.392** The point of Intersection with the N - S center line of the SE 1/4, of section 1, hereinbefore described.

- 21.327** The point of Intersection with the E - W center line of the SE 1/4, of section 1, hereinbefore described.

- 25.652** Right of way station, 160+00, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 160+00 ELEV 3925.67 1961.

N. 19° 17.3' W., beginning new measurement.

- 7.576** Right of way station, 155+00, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 155+00 ELEV 3937.97 1961.

N. 19° 18.2' W., beginning new measurement.

- 7.575** Right of way station, 150+00, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 150+00 ELEV 3907.22 1961.

N. 19° 17.9' W., beginning new measurement.

- 1.819** The monument at the point of intersection with the E - W center line of section 1; hereinbefore described.

From this corner, right of way station, 145+65.3, monumented with an iron post, 2 inches diameter, set in concrete, with the attached brass cap marked, STA 145+65.3, bears N. 19° 17.9' W., 4.768 chains distance.

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD ASSISTANTS

Name	Capacity
Michael Kuta	Surveying Technician

CERTIFICATE OF SURVEY

I, **Larry V. Judd, Cadastral Surveyor**, hereby certify upon honor that, in pursuance of special instructions bearing the date of the *21st day of July, 2000*, I have *executed a dependent resurvey of portions of the east and north boundaries, a portion of the subdivisional lines, the subdivision of sections 1 and 12, and the retracement of a portion of the westerly right of way line of Utah State Highway No. 59, in Township 42 South, Range 13 West,*

of the **Salt Lake Meridian**, in the State of **Utah**, which are represented in the foregoing field notes as having been executed by me and under my direction; and that said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

10/19/01
Date

Larry V. Judd
(Cadastral Surveyor)

Date

(Cadastral Surveyor)

CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT
Salt Lake City, Utah

The foregoing field notes of the *dependent resurvey of portions of the east and north boundaries, a portion of the subdivisional lines, the subdivision of sections 1 and 12, and the retracement of a portion of the westerly right of way line of Utah State Highway No. 59, in Township 42 South, Range 13 West*, executed by **Larry V. Judd, Cadastral Surveyor** having been critically examined and found correct, are hereby approved

October 30, 2001
Date

Daniel W. Webb
(Chief Cadastral Surveyor for Utah)