

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

ORIGINAL

FIELD NOTES

OF

THE DEPENDENT RESURVEY OF

A PORTION OF THE WEST BOUNDARY,

A PORTION OF THE NORTH BOUNDARY,

A PORTION OF THE SUBDIVISIONAL LINES,

AND

THE SUBDIVISION OF SECTIONS 7 AND 30,

IN

TOWNSHIP 23 SOUTH, RANGE 1 WEST,

OF THE SALT LAKE MERIDIAN
IN THE STATE OF UTAH

EXECUTED BY

Jeremy D. Davis
Cadastral Surveyor

Under Special Instructions dated *May 14, 2010*, approved *May 14, 2010*, which provided for the surveys included under Group Number *1145*, and Assignment Instructions dated *May 14, 2010*.

Survey Commenced, *May 24, 2010*
Survey Completed, *July 13, 2010*

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

ORIGINAL

FIELD NOTES

OF

THE DEPENDENT RESURVEY OF

A PORTION OF THE WEST BOUNDARY,

A PORTION OF THE NORTH BOUNDARY,

A PORTION OF THE SUBDIVISIONAL LINES,

AND

THE SUBDIVISION OF SECTIONS 7 AND 30,

IN

TOWNSHIP 23 SOUTH, RANGE 1 WEST,

OF THE SALT LAKE MERIDIAN
IN THE STATE OF UTAH

EXECUTED BY

Jeremy D. Davis
Cadastral Surveyor

Under Special Instructions dated *May 14, 2010*, approved *May 14, 2010*, which provided for the surveys included under Group Number *1145*, and Assignment Instructions dated *May 14, 2010*.

Survey Commenced, *May 24, 2010*
Survey Completed, *July 13, 2010*

INDEX DIAGRAM

Township 23 South, Range 1 West.

7 6 6 12						
5 7 10	13 5	4	3	2	1	
5 18	11 8	9	10	11	12	
4 19 10	17	16	15	14	13	
3 30 9	20	21	22	23	24	
31	9 29	28	27	26	25	
	32	33	34	35	36	

The Subdivision of Section 7.....13
 The Subdivision of Section 30.....15

TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

The following field notes are those of the dependent resurvey of a portion of the west boundary, a portion of the north boundary, a portion of the subdivisional lines, and the subdivision of sections 7 and 30, in T. 23 S., R. 1 W., Salt Lake Meridian, Utah.

HISTORY OF SURVEYS

		Surveyed by	Retr. or Resurveyed by	
SOUTH BOUNDARY				
Portion	A.D. Ferron	1878		
All	H.D. Page & G.C. Swan	1897	H.D. Page & G.C. Swan	1897
Portion			R.C. Yundt	1950
Portion			C.P. Sylvester	1967
EAST BOUNDARY (Salt Lake Meridian)				
All	T.C. Bailey & J.G. Burrill	1874		
All			H.D. Page & G.C. Swan	1897
Portion			R.C. Yundt	1950
All			C.P. Sylvester	1967
WEST BOUNDARY				
Portion	A.D. Ferron	1878		
Portion	J.T. Breckon	1896		
Portion			H.D. Page & G.C. Swan	1897
All			C.P. Sylvester	1967
NORTH BOUNDARY				
Portion	A.D. Ferron	1878		
All	H.D. Page & G.C. Swan	1897	H.D. Page & G.C. Swan	1897
All			C.P. Sylvester	1967
SUBDIVISION				
Portion	A.D. Ferron	1878		
Portion	H.D. Page & G.C. Swan	1897	H.D. Page & G.C. Swan	1897
Portion			R.C. Yundt	1950
Portion			C.P. Sylvester	1967

COUNTY SURVEYS

The Sevier County Surveyor's Office has monumented some corners within the township. No evidence of the Corner Perpetuation and Filing Records could be found at the time of this survey.

PRIVATE SURVEYS

A survey executed by Ryan W. Savage, L.S. 183343, Jones and DeMille Engineering, with a survey plat dated August 11, 2004, is on file at the Sevier County Recorder's Office.

TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

The survey was executed in accordance with the specifications set forth in the Manual of Surveying Instructions, 2009, and the Special Instructions for Group No. 1145, dated May 14, 2010.

The direction of the lines was determined by references to true meridian, established by Global Positioning System (GPS) utilizing Real-Time Kinematic (RTK) techniques throughout the survey. The positional accuracy of this survey complies with the *Standards for the Positional Accuracy of Cadastral Surveys When Using Global Navigation Satellite Systems (GNSS)*, dated February 23, 2009. Trimble model 5800 GPS receivers were used for field collection. Cadastral Measurement Management (CMM) software was the primary software utilized for project calculations.

Preliminary to the resurvey, the lines of the prior surveys were retraced and a search was made for all corners and other calls of record. Identified corners were remonumented in their original positions. Lost corners were reestablished and remonumented at proportionate positions based on the official record. The retracement data was thoroughly verified and only the true line field notes are given herein.

Geodetic control was derived from GPS static observations of, post processed by National Geodetic Survey, Online Positioning User Service (OPUS), utilizing Continuously Operating Reference Stations (CORS): FRED FREDONIA CORS ARP, P009 MARYSVALE_UT2006 CORS ARP, PUC1 CARBON COUNTY COU CORS ARP.

The geographic position of the section corner of sections 7 and 8 only, T. 23 S., R. 1 W., as determined by direct RTK methods from the National Geodetic Survey OPUS solution, is as follows:

Latitude: 38°48'33.528" N.,
Longitude: 111°57'35.828" W., N.A.D. 83,
Network Accuracy = 0.200 meter at 95% confidence level.

The geographic position of the 1/4 section corner of sections 29 and 30, T. 23 S., R. 1 W., as determined by direct RTK methods from the National Geodetic Survey OPUS solution, is as follows:

Latitude: 38°46'21.421" N.,
Longitude: 111°56'28.982" W., N.A.D. 83,
Network Accuracy = 0.200 meter at 95% confidence level.

DEPENDENT RESURVEY OF A PORTION OF THE WEST BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

CHAINS

Dependent Resurvey of a Portion of the West Boundary,
T. 23 S., R. 1 W., Salt Lake Meridian, Utah

Reestablishment of the Survey Executed by J.T Breckon in 1896,
and the Resurveys Executed by H.D. Page and G.C. Swan in 1897,
and C.P Sylvester in 1967

Beginning at the corner of sections 30 and 31 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, in a mound of stone, 3 feet base to top of brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on level ground.

From this corner, the closing corner of sections 25 and 36 only, T. 23 S., R. 2 W., bears S. 0°58.4' E., 0.779 chains distance, as described in the field notes of T. 23 S., R. 2 W., surveyed concurrently under this same group.

N. 0°33.5' W., on the west boundary of section 30.

40.032 Point for the witness corner for the 1/4 section corner of section 25 only, T. 23 S., R. 2 W., at proportionate distance. There is no remaining evidence of the 1967 witness corner.

40.252 True point for the 1/4 section corner of section 25 only, T. 23 S., R. 2 W., at proportionate distance, falls in Utah Hwy. No. 119, where it is not suitable for permanent monumentation.

From the true point, the point selected for an offline witness 1/4 section corner to section 25 only, bears S. 15°48.6' W., 0.501 chains distance.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, flush with ground, magnet at base, with aluminum cap marked:

```

T23S
R2W R1W
WC ↗ 1/4 |
      S25 |
      2010

```

Raise a mound of stone, 3 feet by 2 feet base, 1 foot high, west of the aluminum post.

Set a steel fence post alongside the aluminum post.

Corner falls on south side of Utah Hwy. No. 119, on high berm.

40.642 True point for the 1/4 section corner of section 30 only. Point falls in Utah Hwy. No. 119, where it is not suitable for permanent monumentation. Not monumented.

DEPENDENT RESURVEY OF A PORTION OF THE WEST BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

- 40.872 The witness corner for the 1/4 section corner of section 30 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, in a mound of stone, 2 feet base to top of brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.

Corner falls 30.8 feet north of the centerline of Utah Hwy. No. 119, bears N. 64° E., and S. 64° W.

N. 0°13.0' W., beginning new measurement.

- 40.417 The corner of sections 19, 24, 25, and 30, monumented with an iron post, 2 1/2 inches diameter, firmly set, in a mound of stone, 3 feet base to top of brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.

From the corner, a Sevier County survey monument, an iron pipe, 2 inches diameter, firmly set, projecting 6 inches above the ground, bears N. 89°29.7' W., 0.016 chains distance, with brass cap marked: SEVIER COUNTY 19 24 25 30.

N. 1°48.7' W., on the west boundary of section 19.

- 39.947 The 1/4 section corner of section 24 only, T. 23 S., R. 2 W., monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 6 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on level ground.

N. 0°59.2' W., beginning new measurement.

- 0.433 The 1/4 section corner of section 19 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 6 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on a gradual slope on small hill.

N. 0°16.4' W., beginning new measurement.

- 40.481 The point for the closing corner of sections 13 and 24 only, T. 23 S., R. 2 W., and the amended closing corner, bears N. 88°11.7' W., 0.030 chains distance, as described in the field notes of T. 23 S., R. 2 W., executed concurrently under this same group.

- 41.245 The corner of sections 18 and 19 only, monumented with an iron post, 2 1/2 inches diameter, firmly set in a mound of stone, 2 feet base to top of brass cap marked as described in the

DEPENDENT RESURVEY OF A PORTION OF THE WEST BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

official record of the 1967 resurvey; with a steel fence post alongside the iron post.

Corner falls on level rolling ground in sparse juniper growth.

Reestablishment of the Survey Executed by J.T Breckon in 1896,
and the Resurveys Executed by C.P Sylvester in 1967

N. 0°40.0' W., on the west boundary of section 18.

- 39.438 The 1/4 section corner of section 13 only, T. 23 S., R. 2 W., monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 4 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.

Corner falls on a gradual southeast-facing slope.

N. 0°26.5' W., beginning new measurement.

- 0.757 The 1/4 section corner of section 18 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 4 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.

Corner falls on a gradual southeast-facing slope.

N. 0°27.9' W., beginning new measurement.

- 39.368 The closing corner of sections 12 and 13 only, T. 23 S., R. 2 W., as described in the field notes of T. 23 S., R. 2 W., executed concurrently under this same group.

- 40.098 The corner of sections 7 and 18 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 9 inches above a collar of stone, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.

Corner falls 15 feet west of a wash, and 30 feet west of the foot of a steep hill.

Reestablishment of the Survey Executed by A.D. Ferron in 1878,
and the Resurveys Executed by C.P Sylvester in 1967

N. 0°45.3' W., on the west boundary of section 7.

- 20.847 Point for the S 1/16 section corner of section 7 only. Not monumented.

DEPENDENT RESURVEY OF A PORTION OF THE WEST BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

CHAINS

- 41.327 The 1/4 section corner of section 12 only, T. 23 S., R. 2 W., monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 7 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post alongside the iron post.
- 41.694 The 1/4 section corner of section 7 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 9 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post located alongside the iron post.

Corner falls on an east-facing slope.

N. 0°32.9' W., beginning new measurement.

- 41.717 The corner of sections 1, 6, 7, and 12, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 8 inches above a small mound of stone, with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post located alongside the iron post.

Found the marked stone, firmly set, alongside the iron post.

From this corner, a Sevier County survey monument, an iron pipe, 2 inches diameter, firmly set, projecting 6 inches above the ground, bears N. 52°57.2' W., 0.010 chains distance, with brass cap marked: SEVIER COUNTY 1 6 7 12.

Reestablishment of the Survey Executed by A.D. Ferron in 1878,
and the Resurveys Executed by H.D. Page and G.C. Swan in 1897,
and C.P. Sylvester in 1967

N. 0°32.2' W., between sections 1 and 6.

- 41.290 The 1/4 section corner of sections 1 and 6, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 10 inches above a small mound of stone, with brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on a gradual northwest-facing slope.

N. 0°25.5' W., beginning new measurement.

- 41.200 The point for the corner of Tps. 22 and 23 S., Rs. 1 and 2 W., falls in a gypsum plant waste rock pile; there is no remaining evidence of the 1967 iron post. Not remonumented.

This point perpetuated from original evidence no longer in existence, at distance/distance intersection from existent reference monuments. Ryan Savage, Sevier County Land Surveyor,

DEPENDENT RESURVEY OF A PORTION OF THE WEST BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

CHAINS

verified that this corner was referenced in 2004, while the 1967 iron post was still existent. This position is accepted as a careful and faithful perpetuation of the original corner.

from which

A Sevier County survey monument, an aluminum pipe, 2 1/2 inches diameter, firmly set, projecting 4 inches above the ground, for a reference monument, bears N. 40°12.0' E., 213.5 links distance, with aluminum cap marked: SEVIER COUNTY UTAH SURVEY MONUMENT R2W S36 S1 R1W S31 S6 T23S 2004, with an arrow pointing toward the true point with RM and 140.89 marked along it.

A Sevier County survey monument, an aluminum pipe, 3 inches diameter, firmly set, projecting 2 inches above the ground, for a reference monument, bears S. 45°21.9' E., 213.4 links distance, with aluminum cap marked: SEVIER COUNTY UTAH SURVEY MONUMENT R2W S36 S1 R1W S31 S6 T23S 2004, with an arrow pointing toward the true point with RM and 140.85 marked along it.

Dependent Resurvey of a Portion of the North Boundary,
T. 23 S., R. 1 W., Salt Lake Meridian, Utah

Reestablishment of the Survey Executed by J.T Breckon in 1896,
and the Resurveys Executed by H.D. Page and G.C. Swan in 1897,
and C.P Sylvester in 1967

From the corner of sections 5 and 6 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 7 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a mound of stone, 2 feet base, 8 inches high, southwest of the iron pipe.

A steel fence post is located east of the iron pipe.

A Sevier County survey monument, an iron pipe, 1 1/2 inches diameter, firmly set, projecting 5 inches above the ground, with brass cap marked: SEVIER COUNTY UTAH SURVEY MONUMENT T23SR1W S6 S5 2004, falls alongside the iron post.

Corner falls on level ground, in a bowl opening to the north.

N. 81°45.3' W., on the north boundary of section 6.

- 1.571 The corner of sections 31 and 32 only, T. 22 S., R. 1 W., monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 4 inches above the ground, in a mound of stone, 2 1/2 feet base to top of brass cap marked as described in the official record of the 1967 resurvey.

DEPENDENT RESURVEY OF A PORTION OF THE NORTH BOUNDARY,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

CHAINS

A Sevier County survey monument, an iron pipe, 1 1/2 inches diameter, firmly set, projecting 7 inches above the ground, with brass cap marked: SEVIER COUNTY UTAH SURVEY MONUMENT T22S R1W S31 S32, falls alongside the iron post.

Corner falls on an east-facing slope, on open ground with scattered juniper trees.

N. 88°34.9' W., beginning new measurement.

19.844 Point for the E 1/16 section corner of section 31 only, T. 22 S., R. 1 W. Not monumented.

38.129 The 1/4 section corner of section 6 only, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 11 inches above a mound of stone, 2 1/2 feet base, with brass cap marked as described in the official record of the 1967 resurvey.

Rehabilitate mound of stone, 4 feet base to top of brass cap.

Corner falls on a steep, north-facing slope, on open ground with sagebrush and lava rocks.

39.688 The 1/4 section corner of section 31 only, T. 22 S., R. 1 W., monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 11 inches above a mound of stone, 3 feet base, with brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on a steep, west-facing slope, on open ground with sagebrush and lava rock outcrops.

N. 88°45.4' W., on the north boundary of section 6.

19.861 Point for the W 1/16 section corner of section 31 only, T. 22 S., R. 1 W.

Set an aluminum post, 30 inches long, 2 1/2 inches in diameter, 23 inches in the ground, magnet at base, in a mound of stone, 2 feet base to top of aluminum cap marked:

$$\text{W } \frac{1}{16} \frac{\text{S } 31}{2010}$$

Set a steel fence post alongside the aluminum post.

Corner falls on a gentle north-facing slope, on open ground.

37.179 The point for the corner of Tps. 22 and 23 S., Rs. 1 and 2 W., hereinbefore described.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 23 S., R. 1 W., Salt Lake Meridian, Utah

Reestablishment of the Survey Executed by H.D. Page and G.C. Swan
in 1897, and the Resurvey Executed by and C.P. Sylvester in 1967

From the 1/4 section corner of sections 30 and 31, monumented
with an iron post, 2 1/2 inches diameter, firmly set,
projecting 6 inches above the ground, with brass cap
incorrectly marked:

T23SR1W
S29
1/4 ———
S30
1967

Remark cap:

T23SR1W
S30
1/4 ———
S31
1967

Found a mound of stone 2 feet base by 1 foot high, north of the
iron post.

Corner falls on level ground.

S. 89°18.5' W., between sections 30 and 31.

37.476 The corner of sections 30 and 31 only, on the west boundary of
the township, hereinbefore described.

Reestablishment of the Survey Executed by A.D. Ferron in 1878,
and the Resurveys Executed by H.D. Page and G.C. Swan in 1897,
and C.P. Sylvester in 1967

From the 1/4 section corner of sections 29 and 30, monumented
with an iron post, 2 1/2 inches diameter, firmly set, in a
mound of stone, with brass cap marked as described in the
official record of the 1967 resurvey.

Corner falls on a southwest-facing slope.

N. 1°58.1' E., between sections 29 and 30.

39.048 The corner of sections 19, 20, 29, and 30, monumented with an
iron post, 2 1/2 inches diameter, firmly set, projecting 10
inches above the ground, with brass cap marked as described in

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

the official record of the 1967 resurvey.

Corner falls on top of ridge, bears east and west.

Reestablishment of the Survey Executed by H.D. Page and G.C. Swan
in 1897, and the Resurvey Executed by C.P. Sylvester in 1967

N. 86°54.0' W., between sections 19 and 30.

- 40.089 The 1/4 section corner of sections 19 and 30, monumented with an iron post, 2 1/2 inches diameter, firmly set, flush with the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a mound of stone, 2 feet base, 2 feet high, located east of the iron post.

Corner falls on level ground in scattered juniper growth.

N. 89°18.7' W., beginning new measurement.

- 20.170 Point for the W 1/16 section corner of sections 19 and 30, monumented with a Rex W. Friant survey monument, a rebar, 5/8 inch diameter, firmly set, with orange cap attached marked: R W FRIANT 154652.

This monument, as set by Rex W. Friant, is accepted as a careful and faithful determination of the W 1/16 section corner position.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, magnet at base, with aluminum cap marked:

	S19
W 1/16	———
	S30
	2010

Deposit the rebar and cap at the base of the aluminum post.

Set a steel fence post alongside the aluminum post.

Corner falls on level ground.

- 39.290 The corner of sections 19 and 30, on the west boundary of the township, hereinbefore described.
-

Reestablishment of the Survey Executed by A.D. Ferron in 1878,
and the Resurveys Executed by H.D. Page and G.C. Swan in 1897,
and C.P. Sylvester in 1967

From the corner of sections 7, 8, 17, and 18, monumented with a

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

Sevier County survey monument, an aluminum pipe, 2 1/2 inches diameter, firmly set, projecting 11 inches above a mound of stone, 2 feet base, with aluminum cap marked: SEVIER COUNTY T23SR1W S7 S8 S17 S18 2004.

This monument, as set by Sevier County, is accepted as the best available evidence of the original corner.

A steel fence post falls alongside the aluminum cap.

Corner falls 12 feet north of drainage, on level ground.

S. 87°55.4' W., between sections 7 and 18.

- 39.367 The 1/4 section corner of sections 7 and 18, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 8 inches above a mound of stone, 3 feet base with brass cap marked as described in the official record of the 1967 resurvey; with a steel fence post located alongside the iron post.

Corner falls 7 feet east of drainage.

S. 85°13.5' W., beginning new measurement.

- 19.393 Point for the W 1/16 section corner of sections 7 and 18.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 20 inches in the ground, magnet at base, in a mound of stone, 3 feet base to top of aluminum cap marked:

S7
W 1/16 ———
S18
2010

Set a steel fence post alongside the aluminum post.

Corner falls in a small wash, drains northeast.

- 37.761 The corner of sections 7 and 18 only, on the west boundary of the township, hereinbefore described.

Reestablishment of the Survey Executed by A.D. Ferron in 1878,
and the Resurvey Executed by C.P. Sylvester in 1967

From the corner of sections 7, 8, 17, and 18.

N. 1°10.2' E., between sections 7 and 8.

- 7.151 Point for the witness corner of sections 7, 8, 17, and 18, at proportionate distance; there is no remaining evidence of the 1967 witness corner. Not remonumented.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

- 41.614 Point for the 1/4 section corner of sections 7 and 8, at proportionate distance; there is no remaining evidence of the 1967 iron post. Point falls in a cultivated field, where it is not suitable for permanent monumentation.

From the true point, the point selected for an offline witness 1/4 section corner to sections 7 and 8, bears N. 65°17.5' E., 4.559 chains distance.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 22 inches in the ground, magnet at base, with aluminum cap marked:

T23SR1W
WC 1/4
← S7|S8
2010

Raise a mound of stone, 3 feet by 2 feet base, 1 foot high, north of the aluminum post.

Set a steel fence post alongside the aluminum post.

Corner falls in a fence line, bears southeast and northwest on level ground.

- 48.525 Point for the witness 1/4 section corner for sections 7 and 8, at proportionate distance; there is no remaining evidence of the 1967 witness corner. Not remonumented.

- 83.228 The corner of sections 5, 6, 7, and 8, monumented with an iron post, 2 1/2 inches diameter, projecting 6 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey; with a mound of stone, 2 feet base, 1 foot high, located north of the iron post, and a steel fence post located alongside the iron post.

Corner falls 12 feet west of a deep wash, drains northerly on level ground.

S. 86°54.8' W., between sections 6 and 7.

- 40.459 The 1/4 section corner of sections 6 and 7, monumented with an iron post, 2 1/2 inches diameter, firmly set, projecting 15 inches above the ground, with brass cap marked as described in the official record of the 1967 resurvey.

Corner falls on an east-facing slope.

S. 86°47.7' W., beginning new measurement.

- 39.264 The corner of sections 1, 6, 7, and 12, on the west boundary of the township, hereinbefore described.

DEPENDENT RESURVEY OF A PORTION OF THE SUBDIVISIONAL LINES,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

From the corner of sections 5, 6, 7, and 8.

N. 1°27.0' W., between sections 5 and 6.

- 35.996 The 1/4 section corner of sections 5 and 6, monumented with an iron post, 2 1/2 inches diameter, firmly set, in a mound of stone, 2 feet base to top of brass cap marked as described in the official record of the 1967 resurvey.

N. 1°19.7' W., beginning new measurement.

- 40.067 The corner of sections 5 and 6 only, on the north boundary of the township, hereinbefore described.

The Subdivision of Section 7,
T. 23 S., R. 1 W., Salt Lake Meridian, Utah

From the 1/4 section corner of sections 7 and 18.

N. 0°26.3' E., on the N-S centerline of section 7.

- 20.376 Point for the center S 1/16 section corner.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, magnet at base, with aluminum cap marked:

C
S 1/16 | S7
C
2010

Set a steel fence post alongside the aluminum post.

Corner falls at base of small hill.

- 40.752 Point for the center 1/4 section corner, at intersection with the E-W centerline.

At the corner point

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, with aluminum cap marked:

T23SR1W
C 1/4
S7
2010

Deposit a magnet enclosed in a plastic case at the base of the aluminum post.

Set a steel fence post alongside the aluminum post.

THE SUBDIVISION OF SECTION 7,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

Corner falls on the north face of a small hill, bears east and west.

82.462 The 1/4 section corner of sections 6 and 7.

From the true point for the 1/4 section corner of sections 7 and 8.

S. 86°43.5' W., on the E-W centerline of section 7.

39.940 The point for the center 1/4 section corner.

59.537 Point for the center W 1/16 section corner. Point falls within a juniper, 15 inches diameter. I therefore scribe the tree 1.5 feet from root crown of tree, and add the marks C W 1/16 S7 on the south-facing side of tree.

Corner falls at intersection of shallow washes, drains northwesterly in scattering juniper growth.

78.490 The 1/4 section corner of section 7 only, on the west boundary of the township, hereinbefore described.

From the W 1/16 section corner of sections 7 and 18.

N. 0°05.9' E., on the N-S centerline of the SW 1/4 of section 7.

20.624 Point for the SW 1/16 section corner, at intersection with the E-W centerline of the SW 1/4.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, magnet at base, with aluminum cap marked:

SW 1/16
S7
2010

Set a steel fence post alongside the aluminum post.

Corner falls on an old destroyed road, bears northeast and southwest.

41.246 The point for the center W 1/16 section corner of section 7.

From the center S 1/16 section corner of section 7.

S. 85°58.9' W., on the E-W centerline of the SW 1/4.

19.493 The SW 1/16 section corner.

38.153 The point for the S 1/16 section corner of section 7 only, on the west boundary of the township, hereinbefore described.

THE SUBDIVISION OF SECTION 30,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH

CHAINS

The Subdivision of Section 30,
T. 23 S., R 1 W., Salt Lake Meridian, Utah

From the 1/4 section corner of sections 30 and 31.

N. 0°54.4' E., on the N-S centerline of section 30.

- 39.689 Point for the center 1/4 section corner, at intersection with the E-W centerline.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 24 inches in the ground, magnet at base, with aluminum cap marked:

T23SR1W
C 1/4
S30
2010

Set a steel fence post alongside the aluminum post.

Corner falls on level ground.

- 80.372 The 1/4 section corner of sections 19 and 30.
-

From the 1/4 section corner of sections 29 and 30.

N. 89°15.1' W., on the E-W centerline of section 30.

- 39.341 The center 1/4 section corner.

- 59.126 Point for the center W 1/16 section corner of section 30.

Set an aluminum post, 30 inches long, 2 1/2 inches diameter, 18 inches in the ground, magnet at base, in a mound of stone, 3 feet base to top of aluminum cap marked:

W 1/16
C — C
S30
2010

Set a steel fence post alongside the aluminum post.

Corner falls on a steep north-facing slope.

From this corner point, a Rex W. Friant survey monument, a rebar, 5/8 inch diameter, firmly set, bears N. 63°22.4' E., 0.081 chains distance, with orange cap attached marked: R.W. FRIANT RLS 154652.

- 77.839 The true point for the 1/4 section corner of section 30 only, on the west boundary of the township, hereinbefore described.
-

THE SUBDIVISION OF SECTION 30,
TOWNSHIP 23 SOUTH, RANGE 1 WEST, SALT LAKE MERIDIAN, UTAH
CHAINS

From the center W 1/16 section corner of section 30.

N. 0°21.6' E., on the N-S centerline of the NW 1/4 of section
30.

40.661 The W 1/16 section corner of sections 19 and 30.

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

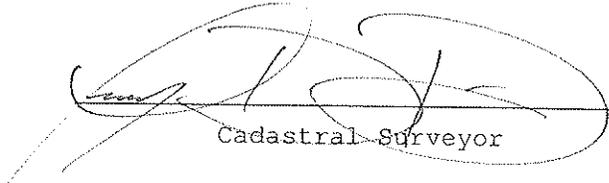
FIELD ASSISTANTS

Name	Capacity
Ronald K. Baugh	Cadastral Surveyor
Vincent Porter	Survey Aid
Jacob Murdock	Survey Aid

CERTIFICATE OF SURVEY

I, *Jeremy D. Davis*, Cadastral Surveyor, HEREBY CERTIFY upon honor, that in pursuance of Special Instructions bearing the date of the 14th day of May, 2010, I have dependently resurveyed a portion of the west boundary, a portion of the north boundary, a portion of the subdivisional lines, and subdivided sections 7 and 30, in Township 23 South, Range 1 West, of the Salt Lake Meridian, in the State of Utah, which are represented in the foregoing field notes as having been executed by me and under my direction; and that said survey has been made in strict conformity with said Special Instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

November 10, 2011
Date

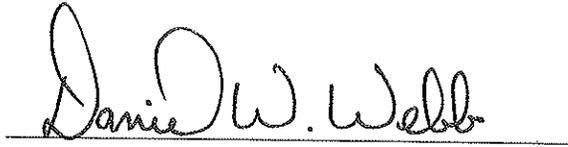

Cadastral Surveyor

CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT
Salt Lake City, Utah

The foregoing field notes of the *dependent resurvey of a portion of the west boundary, a portion of the north boundary, a portion of the subdivisional lines, and the subdivision of sections 7 and 30, in Township 23 South, Range 1 West, Salt Lake Meridian, Utah, executed by Jeremy D. Davis, Cadastral Surveyor,* having been critically examined and found correct, are hereby approved.

March 9, 2012
Date


Chief Cadastral Surveyor for Utah